


DATA SHEET

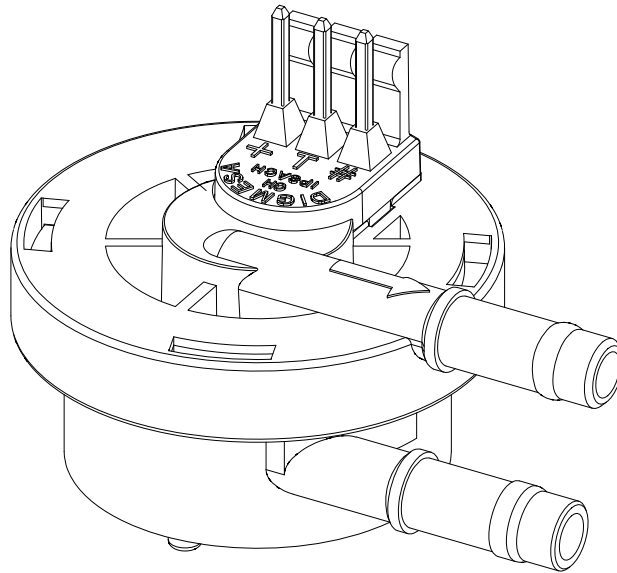

DIGimesa[®]
CHOOSE THE ORIGINAL

FHKSC PVDF using fastening pin
with double isolation
Part number: 932-930X/PXXXX

Digimesa AG, Keltenstrasse 31, CH-2563 Ipsach / Switzerland
Phone +41 (32) 332 77 77, Fax +41 (32) 332 77 88

www.digimesa.com

Version 01 FHKSC 932-930x/Pxxxx GB 20V Seite 1-21

General Description

The FHKSC Flowmeter is a general-purpose device. The device is installed between the tank container and the vibratory pump (on the suction side) and in this way prevents the measuring errors that arise during pulsating flow caused by vibratory pumps.

Specific applications: Thanks to its closure system, the water outlet side can be assembled in four different positions. Central sprayed fastening pin \varnothing 2.8mm x 7.5mm. Recommended washer

disk: Quicklock® Benzing \varnothing 3mm or Starlock P-6490 \varnothing 3mm.

Employed in the semiconductor (wafer polishing) sector due to the high purity of materials used. Doubled isolation (water/electronics)

Approvals / Standards

EN55014-1:00+A1:01+A2:02, EN61000-6-3:01+A11:04, IEC61000-6-3:06(ed.2.0), EN61000-3-2:06, IEC61000-3-2:05(ed.3.0), EN61000-3-3:95+A1:01+A2:05, IEC61000-3-3:94+A1:01+A2:05(Cons.ed.1.2), EN55014-2:97+A1:01, EN61000-6-1:01, IEC61000-6-1:05(ed.2)



Material:

| | |
|--------------|---|
| Housing: | PVDF |
| Bearing pin: | Injection-moulded like the housing |
| Nozzle: | Injection-moulded like the housing |
| O-ring: | FPM (Viton) |
| Turbine: | PFA 2 Magnets 4 Magnets on request |
| Magnets: | Ceramic Sr Fe O (not in contact with the medium) |


Technical data:

| | |
|---------------------|--|
| Flow rate: | 0.033 - 2 l/min depending on the nozzle diameter |
| Measuring accuracy: | +/- 2.0% |
| Repetition: | < +/- 0.25% |
| Temperature range: | -10°C to +65°C 14°F to 149°F |
| Pressure range: | -1 bar to 0.3 bar at 20°C -14.5 psi to 4.35 psi /68°F |
| Mounting position: | Horizontal * |
| Nozzle size: | \varnothing 1.0, 1.2, 1.8, 2.0 mm |

Electrical connection ratings:

| | |
|--------------------|-----------------------------------|
| Power supply: | +3.8 to +20 VDC |
| Consumption: | < 8 mA |
| Signal connection: | Open collector NPN |
| Signal voltage: | 0 VDC GND (saturation < 0.7 V) |
| Signal load: | max. 20 mA |
| Leakage current: | max. 10 μ A |
| Connections: | PANCON MAS-CON 156 MLSS |
| Signal: | Square-wave output |
| Duty Cycle: | ~ 50% |

Dimensions in mm:

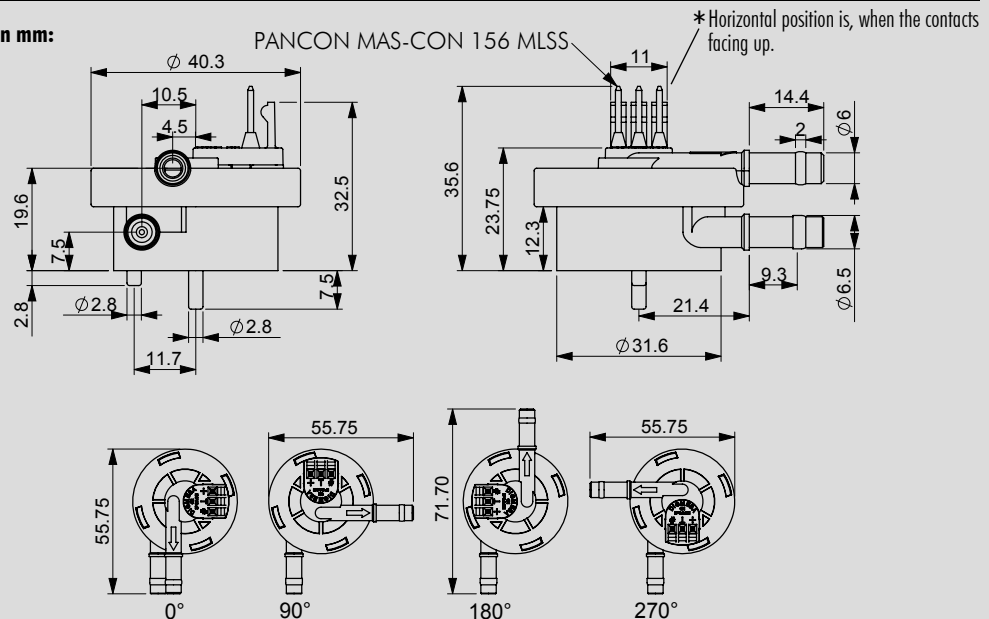

RESISTANCE




Special regulations which must be complied with by the flowmeter manufacturer apply to each country, e.g. CE, NSF, FDA and SK. The various media flowing through the flowmeter differ from application to application. You are advised to enquire with the medium manufacturer as to whether the entire installation and the flowmeter are resistant to the medium itself (see Material)!


ELECTRONIC

DIGMESA electronic circuitry is always designed for operation with DIGMESA flowmeters. Please note the following if connecting to other electronic circuitry:



- The flowmeter does not supply an output voltage but switches the signal terminal to 0 V ground (actuated) or leaves it open (non-actuated)
- There must be a pull-up resistor between power supply + and signal depending on electronic circuitry!

Interface Connection: Examples Open Collector

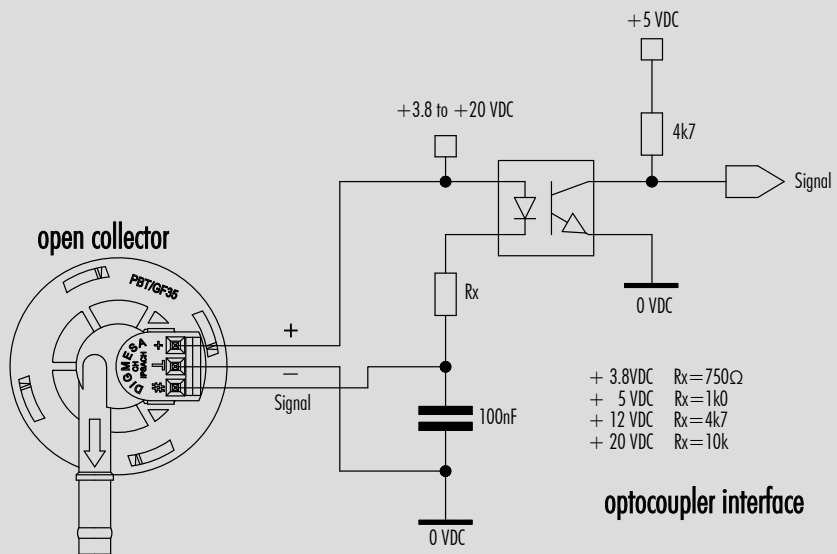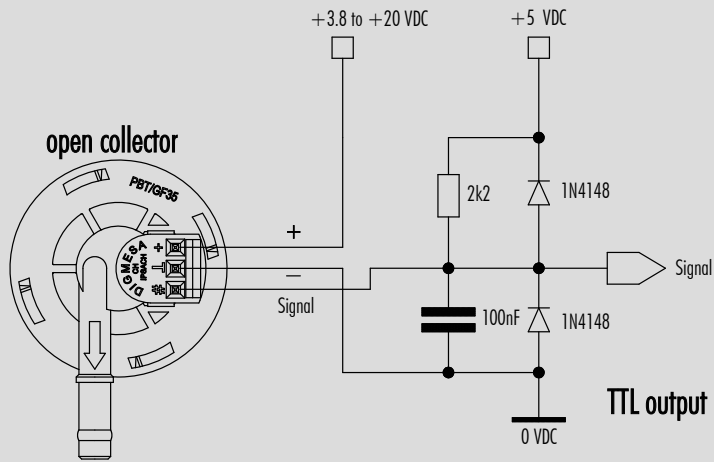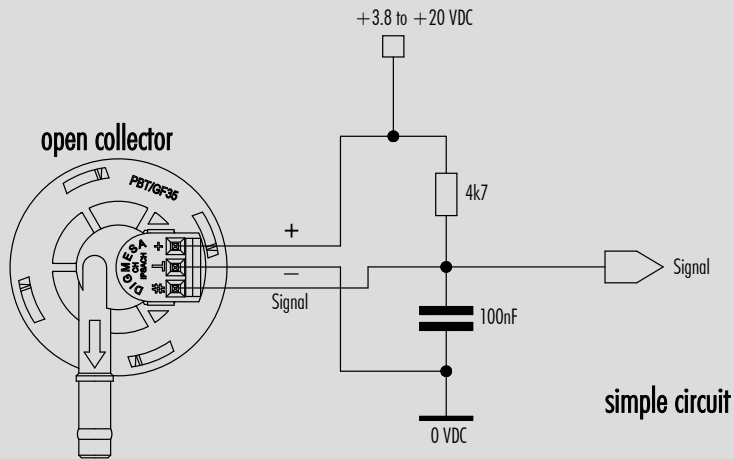

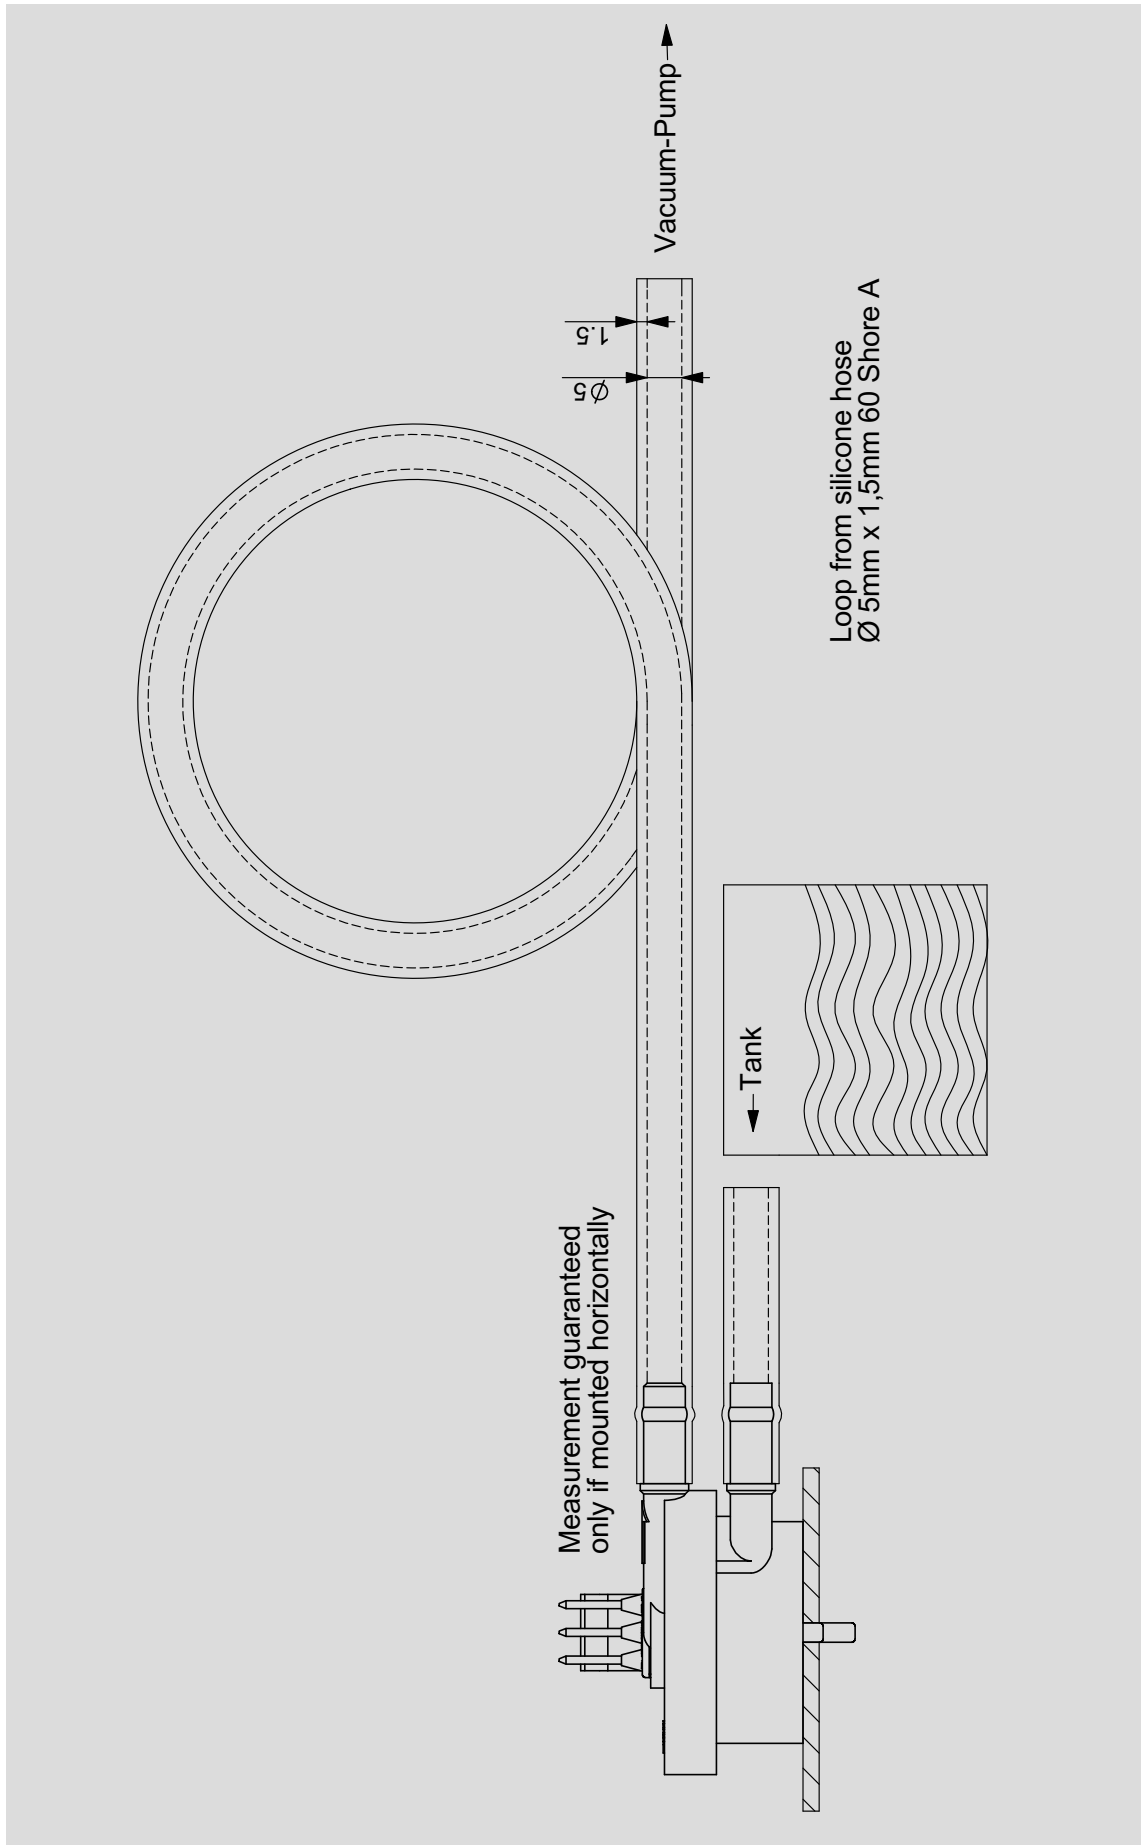

Measurement Curve FHKSC 1.00 mm 0° Arnite

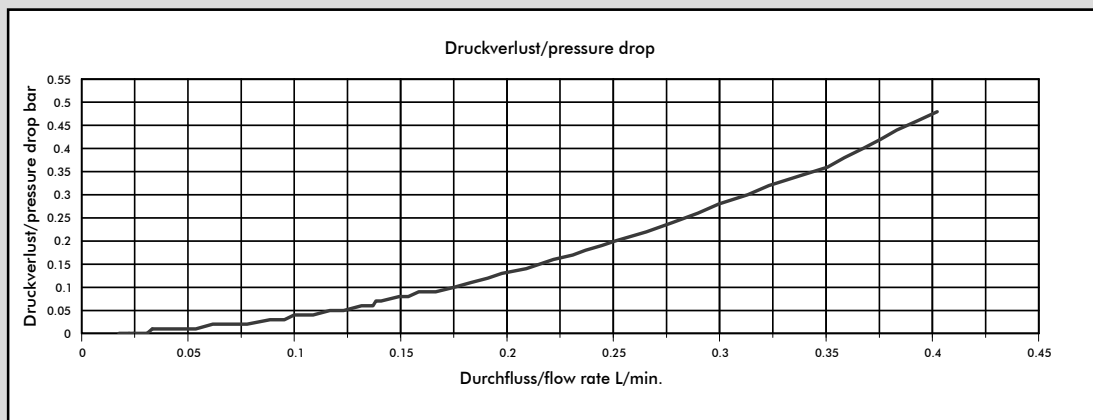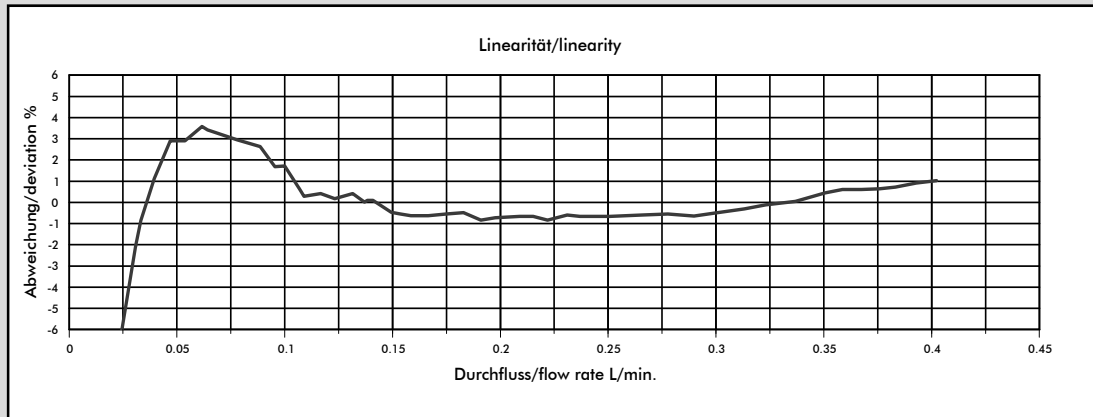

Medium: Water / max. Pressure: 1 bar

#932-9305/P2 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2382 | 0.4197 | 0.0333 | 0.4023 | 0.48 |
| Ø 1.20 mm | 1925 | 0.5194 | 0.0750 | 0.5692 | 0.42 |
| Ø 1.80 mm | 1315 | 0.7601 | 0.0753 | 0.8994 | 0.25 |
| Ø 2.00 mm | 1250 | 0.8001 | 0.1121 | 0.9068 | 0.21 |

#932-9305/P4 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4764 | 0.2098 | 0.0333 | 0.4023 | 0.48 |
| Ø 1.20 mm | 3850 | 0.2597 | 0.0750 | 0.5692 | 0.42 |
| Ø 1.80 mm | 2630 | 0.3800 | 0.0753 | 0.8994 | 0.25 |
| Ø 2.00 mm | 2500 | 0.4000 | 0.1121 | 0.9068 | 0.21 |

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.



We reserve the right to make modifications in the interests of technical progress.

Version 01 FHKSC 932-9305/Pxxxx GB 20V Seite 5-21

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Measurement Curve FHKSC 1.00 mm 90° Arnite

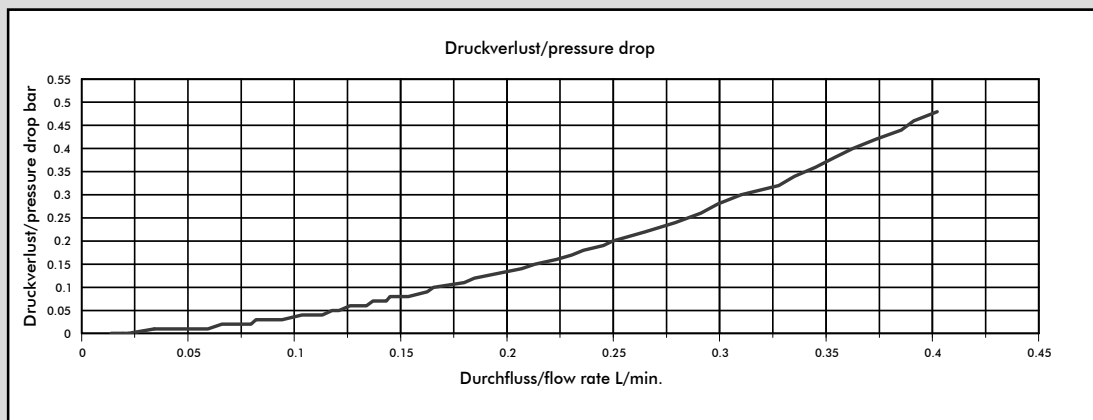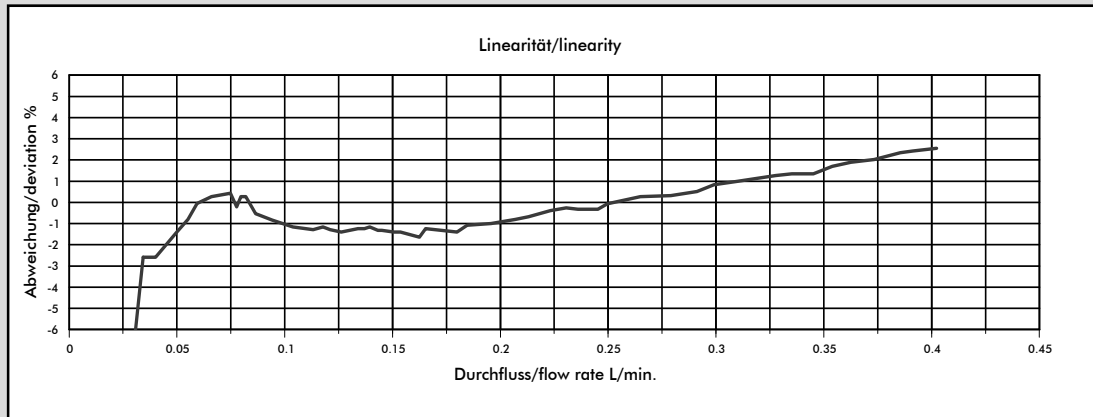

Medium: Water / max. Pressure: 1 bar

#932-9305/P902 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2386 | 0.4191 | 0.0500 | 0.4023 | 0.48 |
| Ø 1.20 mm | 1934 | 0.5171 | 0.0813 | 0.5667 | 0.43 |
| Ø 1.80 mm | 1300 | 0.7691 | 0.0910 | 0.9012 | 0.25 |
| Ø 2.00 mm | 1215 | 0.8231 | 0.1396 | 0.9156 | 0.21 |

#932-9305/P904 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4772 | 0.2095 | 0.0500 | 0.4023 | 0.48 |
| Ø 1.20 mm | 3868 | 0.2585 | 0.0813 | 0.5667 | 0.43 |
| Ø 1.80 mm | 2600 | 0.3845 | 0.0910 | 0.9012 | 0.25 |
| Ø 2.00 mm | 2430 | 0.4115 | 0.1396 | 0.9156 | 0.21 |

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.



We reserve the right to make modifications in the interests of technical progress.

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Version 01 FHKSC 932-9305/Pxxx GB 20V Seite 6-21

Measurement Curve FHKSC 1.00 mm 180° Arnite

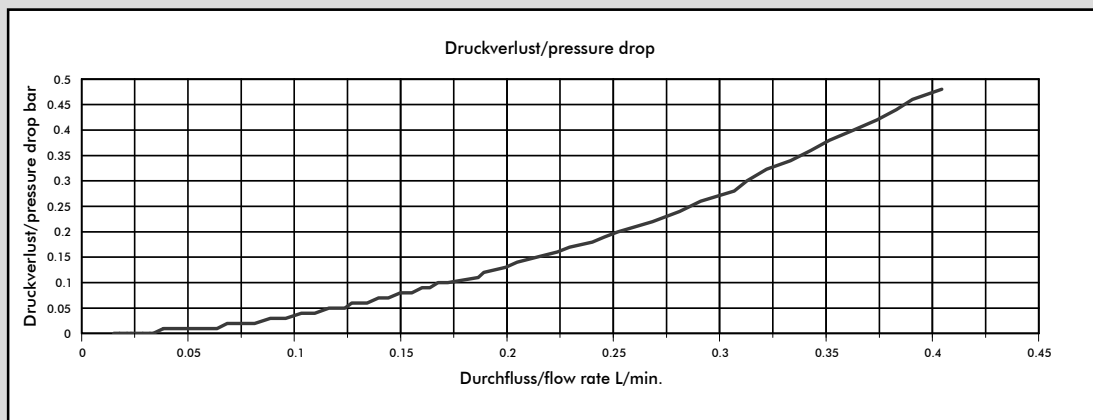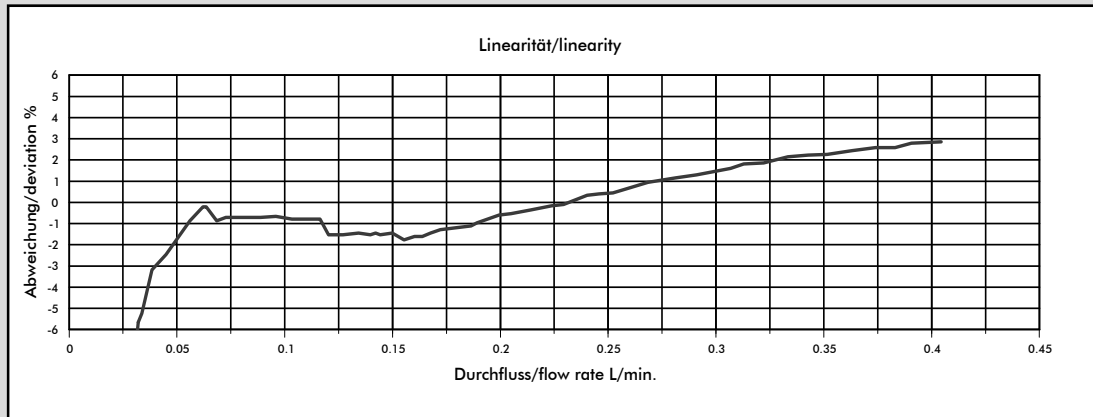

Medium: Water / max. Pressure: 1 bar

#932-9305/P1802 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2476 | 0.4038 | 0.0560 | 0.4044 | 0.48 |
| Ø 1.20 mm | 2016 | 0.4960 | 0.1022 | 0.5705 | 0.43 |
| Ø 1.80 mm | 1360 | 0.7349 | 0.1185 | 0.8966 | 0.26 |
| Ø 2.00 mm | 1280 | 0.7815 | 0.1785 | 0.9175 | 0.22 |

#932-9305/P1804 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4952 | 0.2019 | 0.0560 | 0.4044 | 0.48 |
| Ø 1.20 mm | 4032 | 0.2480 | 0.1022 | 0.5705 | 0.43 |
| Ø 1.80 mm | 2720 | 0.3674 | 0.1185 | 0.8966 | 0.26 |
| Ø 2.00 mm | 2560 | 0.3907 | 0.1785 | 0.9175 | 0.22 |

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.



We reserve the right to make modifications in the interests of technical progress.

Version 01 FHKSC 932-9305/Pxxxx GB 20V Seite 7-21

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Measurement Curve FHKSC 1.00 mm 270° Arnite

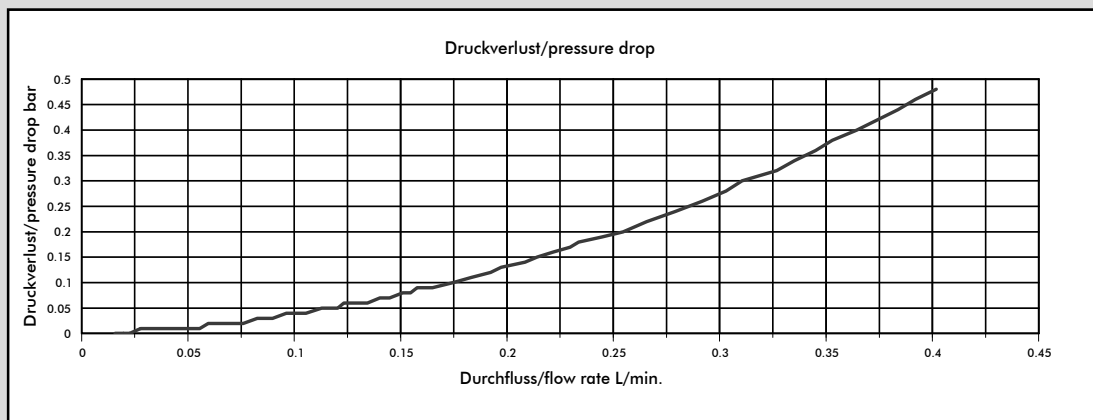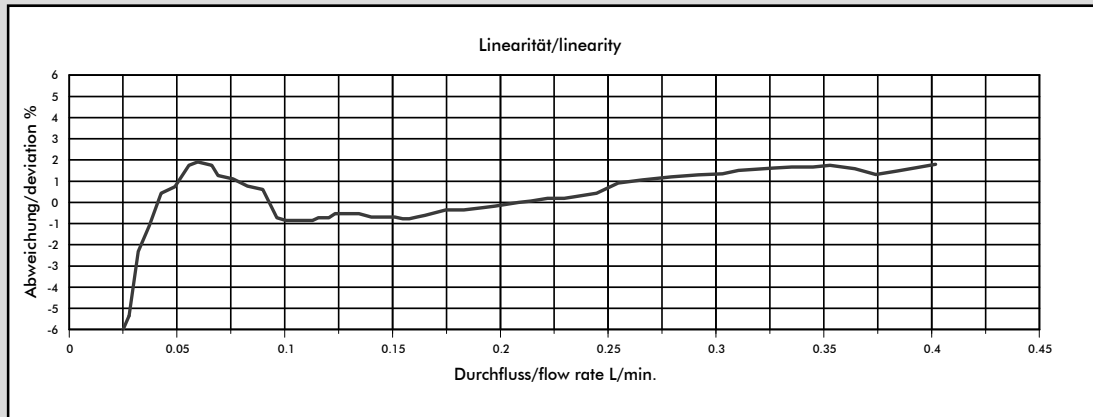

Medium: Water / max. Pressure: 1 bar

#932-9305/P2702 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2436 | 0.4105 | 0.0427 | 0.4019 | 0.48 |
| Ø 1.20 mm | 2012 | 0.4969 | 0.0801 | 0.5677 | 0.42 |
| Ø 1.80 mm | 1352 | 0.7397 | 0.0824 | 0.8982 | 0.26 |
| Ø 2.00 mm | 1274 | 0.7849 | 0.1573 | 0.9056 | 0.22 |

#932-9305/P2704 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4872 | 0.2052 | 0.0427 | 0.4019 | 0.48 |
| Ø 1.20 mm | 4024 | 0.2484 | 0.0801 | 0.5677 | 0.42 |
| Ø 1.80 mm | 2704 | 0.3698 | 0.0824 | 0.8982 | 0.26 |
| Ø 2.00 mm | 2548 | 0.3924 | 0.1573 | 0.9056 | 0.22 |

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.



We reserve the right to make modifications in the interests of technical progress.

Version 01 FHKSC 932-9305/Pxxxx GB 20V Seite 8-21

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Measurement Curve FHKSC 1.20 mm 0° Arnite

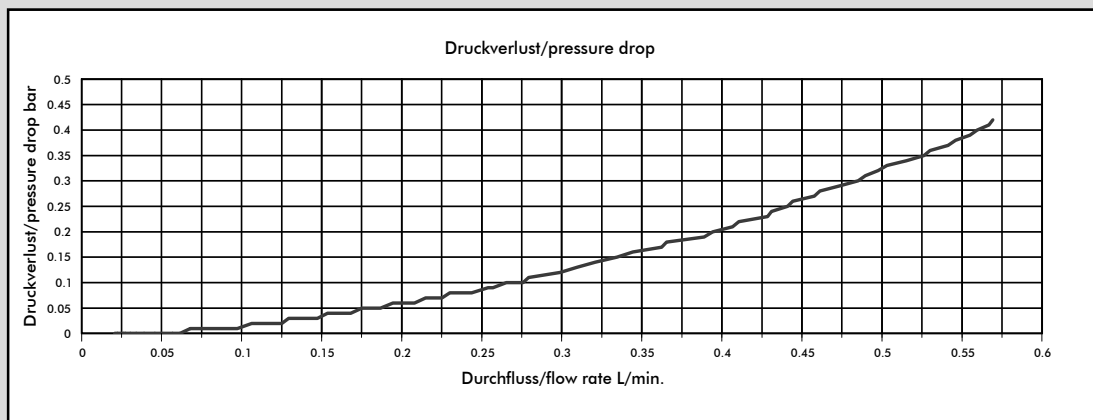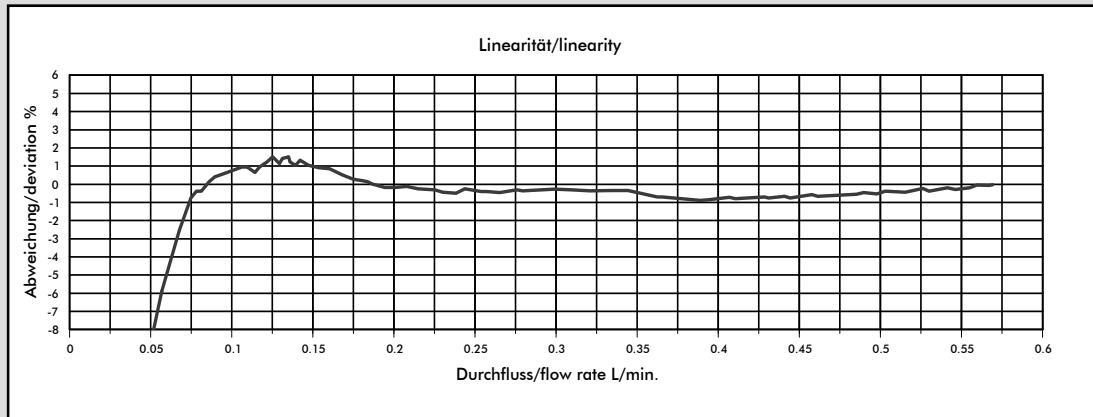

Medium: Water / max. Pressure: 1 bar

#932-9301/P2 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2382 | 0.4197 | 0.0333 | 0.4023 | 0.48 |
| Ø 1.20 mm | 1925 | 0.5194 | 0.0750 | 0.5692 | 0.42 |
| Ø 1.80 mm | 1315 | 0.7601 | 0.0753 | 0.8994 | 0.25 |
| Ø 2.00 mm | 1250 | 0.8001 | 0.1121 | 0.9068 | 0.21 |

#932-9301/P4 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4764 | 0.2098 | 0.0333 | 0.4023 | 0.48 |
| Ø 1.20 mm | 3850 | 0.2597 | 0.0750 | 0.5692 | 0.42 |
| Ø 1.80 mm | 2630 | 0.3800 | 0.0753 | 0.8994 | 0.25 |
| Ø 2.00 mm | 2500 | 0.4000 | 0.1121 | 0.9068 | 0.21 |

The values specified must be considered as approximate values.



The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Measurement Curve FHKSC 1.20 mm 90° Arnite

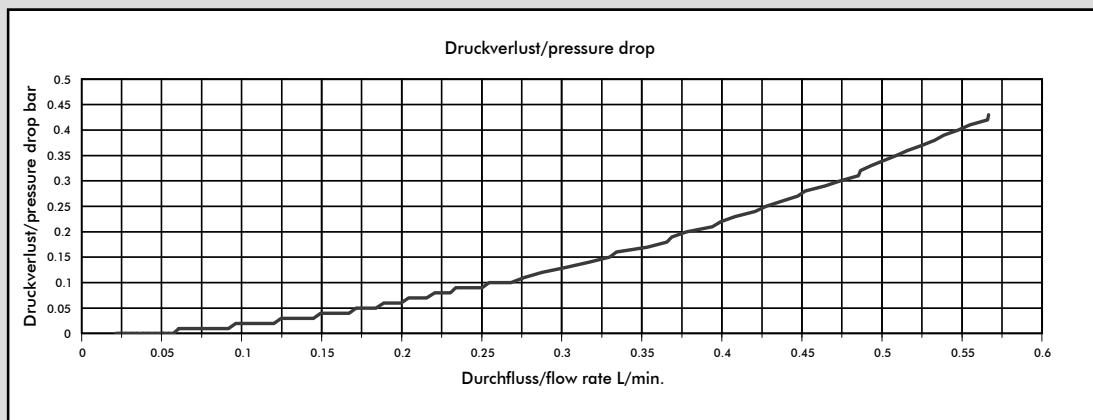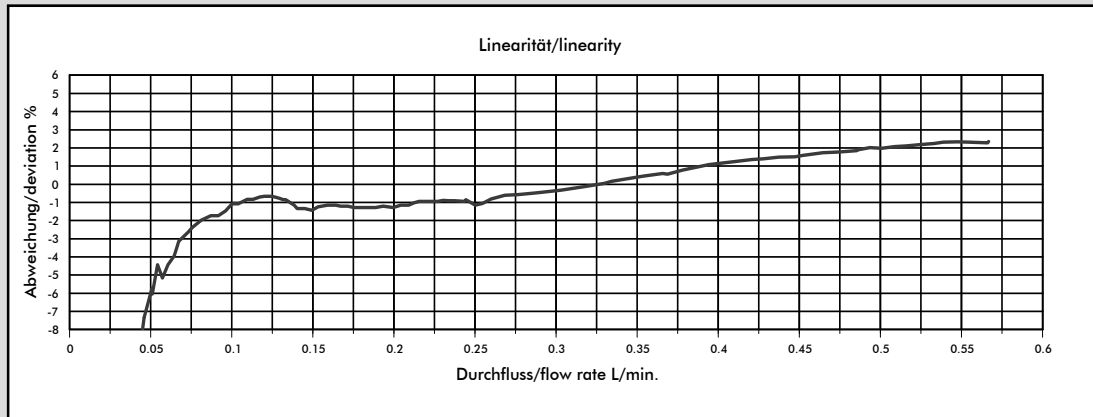

Medium: Water / max. Pressure: 1 bar

#932-9301/P902 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2386 | 0.4191 | 0.0500 | 0.4023 | 0.48 |
| Ø 1.20 mm | 1934 | 0.5171 | 0.0813 | 0.5667 | 0.43 |
| Ø 1.80 mm | 1300 | 0.7691 | 0.0910 | 0.9012 | 0.25 |
| Ø 2.00 mm | 1215 | 0.8231 | 0.1396 | 0.9156 | 0.21 |

#932-9301/P904 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4772 | 0.2095 | 0.0500 | 0.4023 | 0.48 |
| Ø 1.20 mm | 3868 | 0.2585 | 0.0813 | 0.5667 | 0.43 |
| Ø 1.80 mm | 2600 | 0.3845 | 0.0910 | 0.9012 | 0.25 |
| Ø 2.00 mm | 2430 | 0.4115 | 0.1396 | 0.9156 | 0.21 |

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.



We reserve the right to make modifications in the interests of technical progress.

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Version 01 FHKSC 932-930w/Pxxx GB 20V Seite 10-21

Measurement Curve FHKSC 1.20 mm 180° Arnite

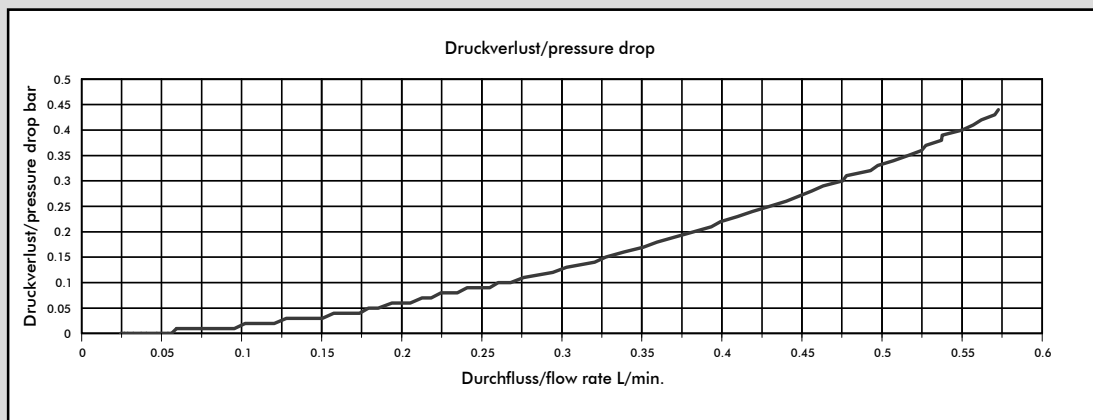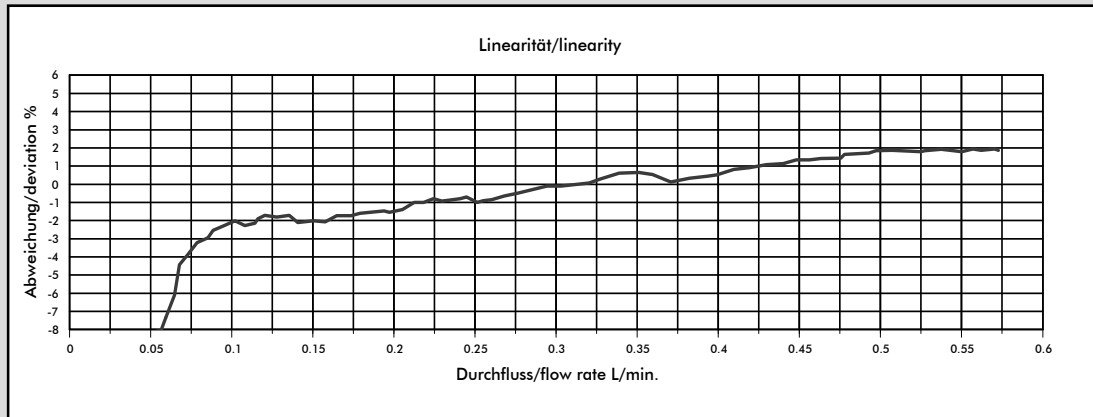

Medium: Water / max. Pressure: 1 bar

#932-9301/P1802 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2476 | 0.4038 | 0.0560 | 0.4044 | 0.48 |
| Ø 1.20 mm | 2016 | 0.4960 | 0.1022 | 0.5705 | 0.43 |
| Ø 1.80 mm | 1360 | 0.7349 | 0.1185 | 0.8966 | 0.26 |
| Ø 2.00 mm | 1280 | 0.7815 | 0.1785 | 0.9175 | 0.22 |

#932-9301/P1804 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4952 | 0.2019 | 0.0560 | 0.4044 | 0.48 |
| Ø 1.20 mm | 4032 | 0.2480 | 0.1022 | 0.5705 | 0.43 |
| Ø 1.80 mm | 2720 | 0.3674 | 0.1185 | 0.8966 | 0.26 |
| Ø 2.00 mm | 2560 | 0.3907 | 0.1785 | 0.9175 | 0.22 |

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.



We reserve the right to make modifications in the interests of technical progress.

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Version 01 FHKSC 932-930w/Pxxx GB 20V Seite 11-21

Measurement Curve FHKSC 1.20 mm 270° Arnite

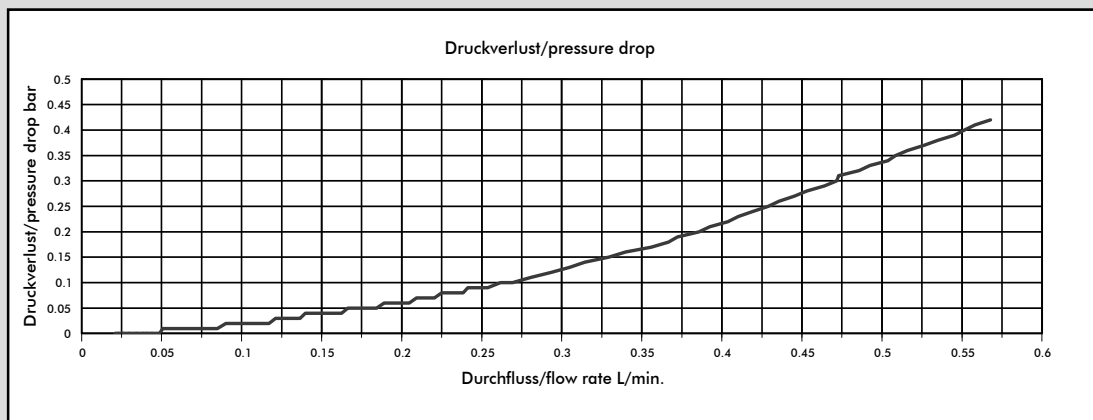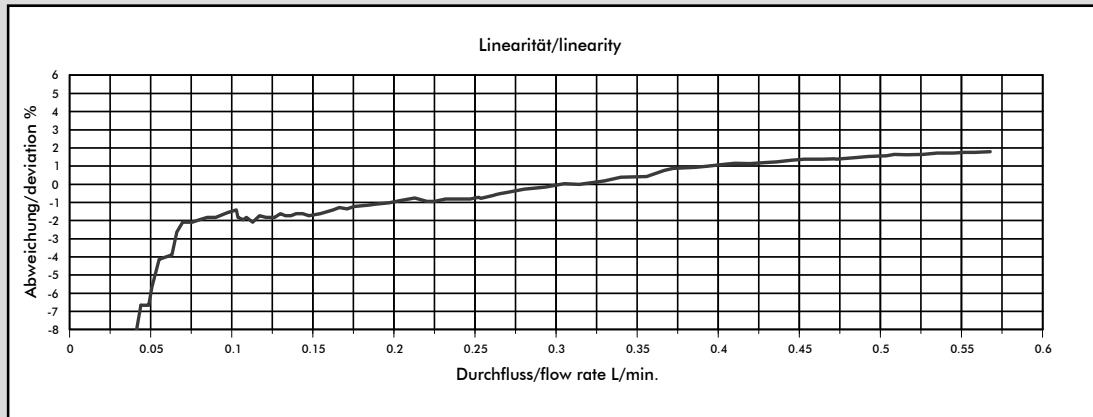

Medium: Water / max. Pressure: 1 bar

#932-9301/P2702 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|---------------------------------|---------------|
| Ø 1.00 mm | 2436 | 0.4105 | 0.0427 | 0.4019 | 0.48 |
| Ø 1.20 mm | 2012 | 0.4969 | 0.0801 | 0.5677 | 0.42 |
| Ø 1.80 mm | 1352 | 0.7397 | 0.0824 | 0.8982 | 0.26 |
| Ø 2.00 mm | 1274 | 0.7849 | 0.1573 | 0.9056 | 0.22 |

#932-9301/P2704 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|---------------------------------|---------------|
| Ø 1.00 mm | 4872 | 0.2052 | 0.0427 | 0.4019 | 0.48 |
| Ø 1.20 mm | 4024 | 0.2484 | 0.0801 | 0.5677 | 0.42 |
| Ø 1.80 mm | 2704 | 0.3698 | 0.0824 | 0.8982 | 0.26 |
| Ø 2.00 mm | 2548 | 0.3924 | 0.1573 | 0.9056 | 0.22 |

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.



We reserve the right to make modifications in the interests of technical progress.

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Version 01 FHKSC 932-930w/Pxxx GB 20V Seite 12-21

Measurement Curve FHKSC 1.80 mm 0° Arnite

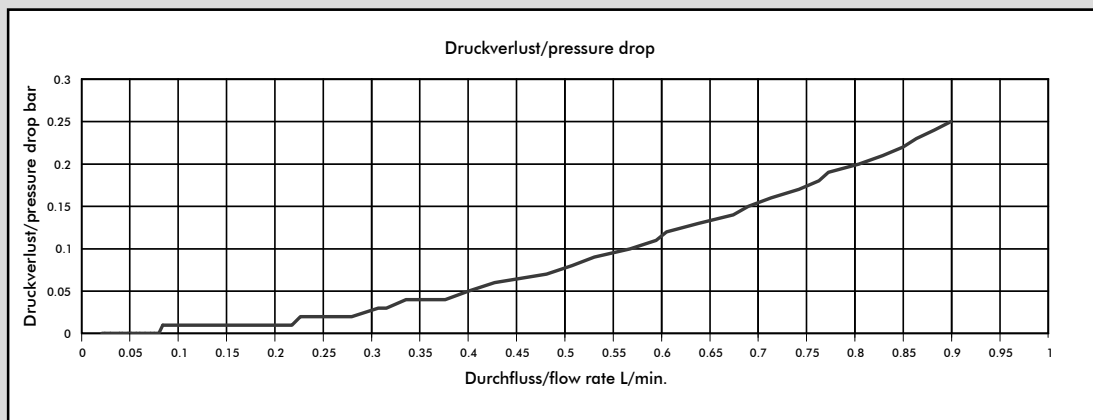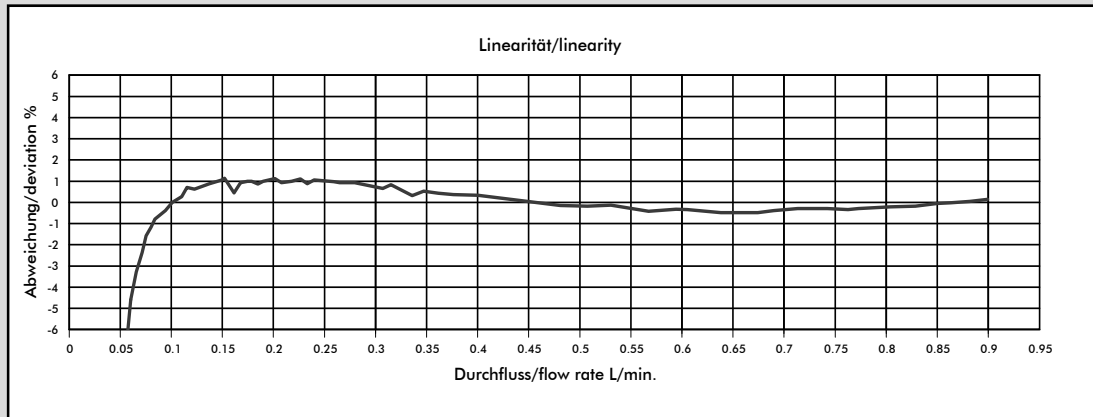

Medium: Water / max. Pressure: 1 bar

#932-9304/P2 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2382 | 0.4197 | 0.0333 | 0.4023 | 0.48 |
| Ø 1.20 mm | 1925 | 0.5194 | 0.0750 | 0.5692 | 0.42 |
| Ø 1.80 mm | 1315 | 0.7601 | 0.0753 | 0.8994 | 0.25 |
| Ø 2.00 mm | 1250 | 0.8001 | 0.1121 | 0.9068 | 0.21 |

#932-9304/P4 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4764 | 0.2098 | 0.0333 | 0.4023 | 0.48 |
| Ø 1.20 mm | 3850 | 0.2597 | 0.0750 | 0.5692 | 0.42 |
| Ø 1.80 mm | 2630 | 0.3800 | 0.0753 | 0.8994 | 0.25 |
| Ø 2.00 mm | 2500 | 0.4000 | 0.1121 | 0.9068 | 0.21 |

The values specified must be considered as approximate values.



The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Measurement Curve FHKSC 1.80 mm 90° Arnite

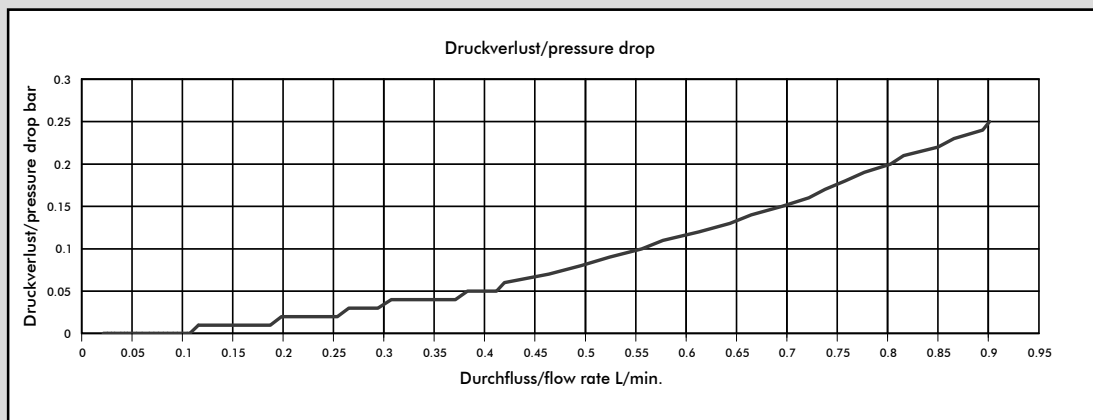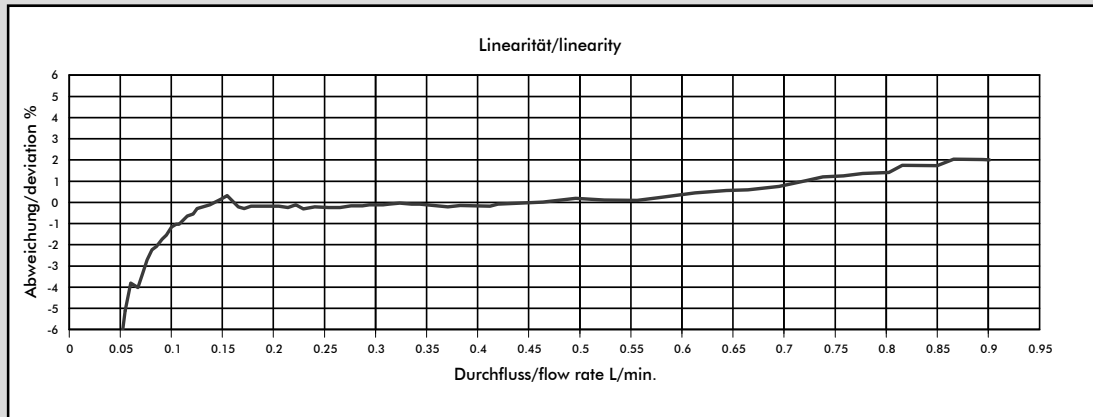

Medium: Water / max. Pressure: 1 bar

#932-9304/P902 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2386 | 0.4191 | 0.0500 | 0.4023 | 0.48 |
| Ø 1.20 mm | 1934 | 0.5171 | 0.0813 | 0.5667 | 0.43 |
| Ø 1.80 mm | 1300 | 0.7691 | 0.0910 | 0.9012 | 0.25 |
| Ø 2.00 mm | 1215 | 0.8231 | 0.1396 | 0.9156 | 0.21 |

#932-9304/P904 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4772 | 0.2095 | 0.0500 | 0.4023 | 0.48 |
| Ø 1.20 mm | 3868 | 0.2585 | 0.0813 | 0.5667 | 0.43 |
| Ø 1.80 mm | 2600 | 0.3845 | 0.0910 | 0.9012 | 0.25 |
| Ø 2.00 mm | 2430 | 0.4115 | 0.1396 | 0.9156 | 0.21 |

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.



We reserve the right to make modifications in the interests of technical progress.

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Version 01 FHKSC 932-930w/Pxxx GB 20V Seite 14-21

Measurement Curve FHKSC 1.80 mm 180° Arnite

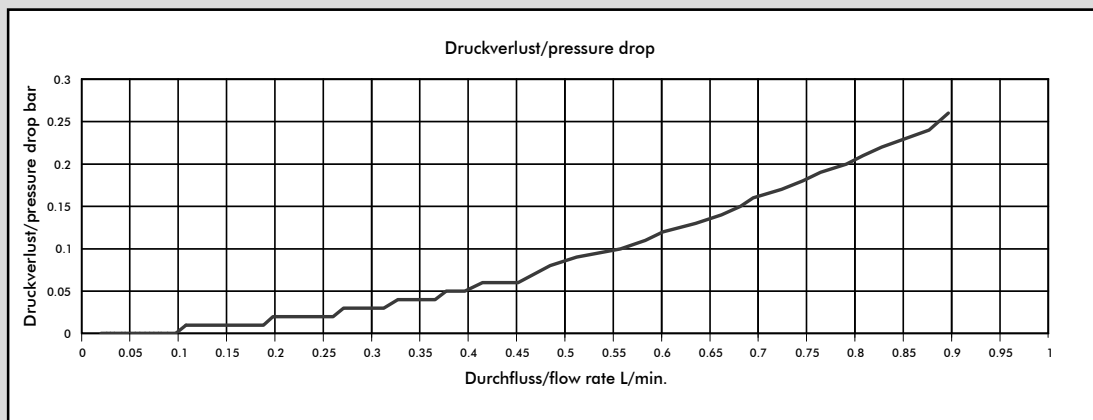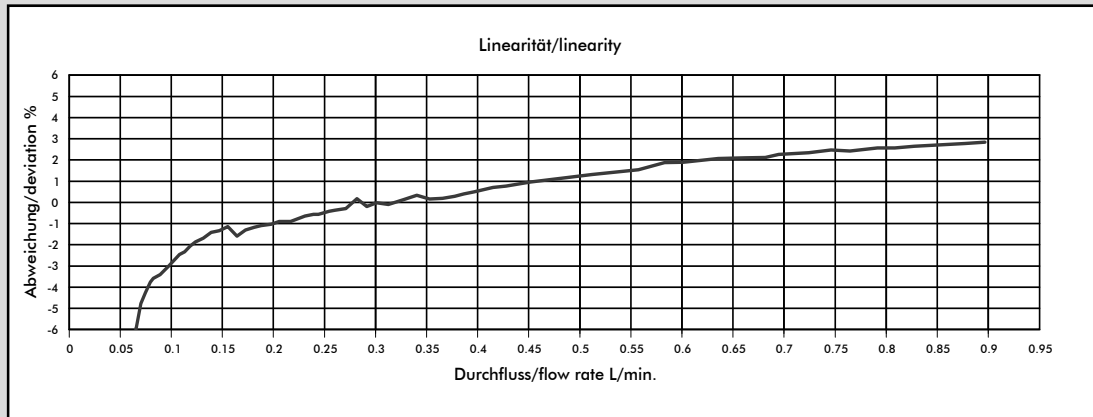

Medium: Water / max. Pressure: 1 bar

#932-9304/P1802 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2476 | 0.4038 | 0.0560 | 0.4044 | 0.48 |
| Ø 1.20 mm | 2016 | 0.4960 | 0.1022 | 0.5705 | 0.43 |
| Ø 1.80 mm | 1360 | 0.7349 | 0.1185 | 0.8966 | 0.26 |
| Ø 2.00 mm | 1280 | 0.7815 | 0.1785 | 0.9175 | 0.22 |

#932-9304/P1804 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4952 | 0.2019 | 0.0560 | 0.4044 | 0.48 |
| Ø 1.20 mm | 4032 | 0.2480 | 0.1022 | 0.5705 | 0.43 |
| Ø 1.80 mm | 2720 | 0.3674 | 0.1185 | 0.8966 | 0.26 |
| Ø 2.00 mm | 2560 | 0.3907 | 0.1785 | 0.9175 | 0.22 |

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.



We reserve the right to make modifications in the interests of technical progress.

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Version 01 FHKSC 932-930w/Pxxx GB 20V Seite 15-21

Measurement Curve FHKSC 1.80 mm 270° Arnite

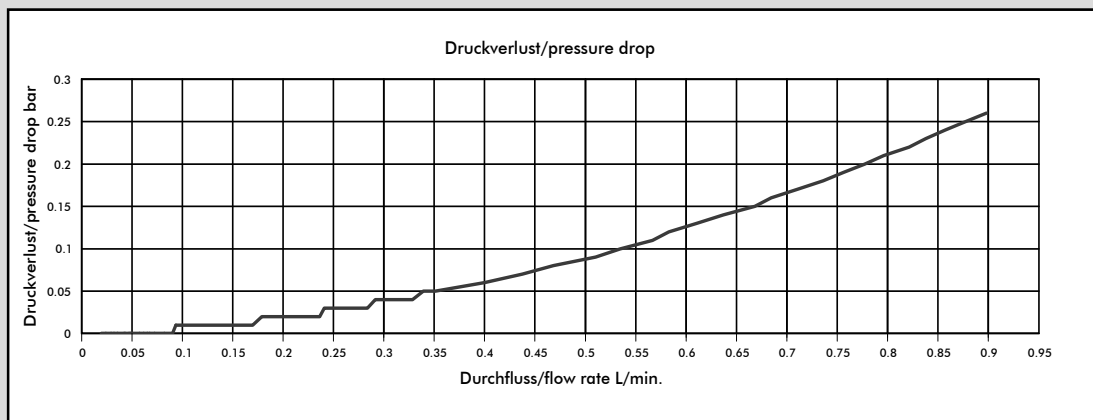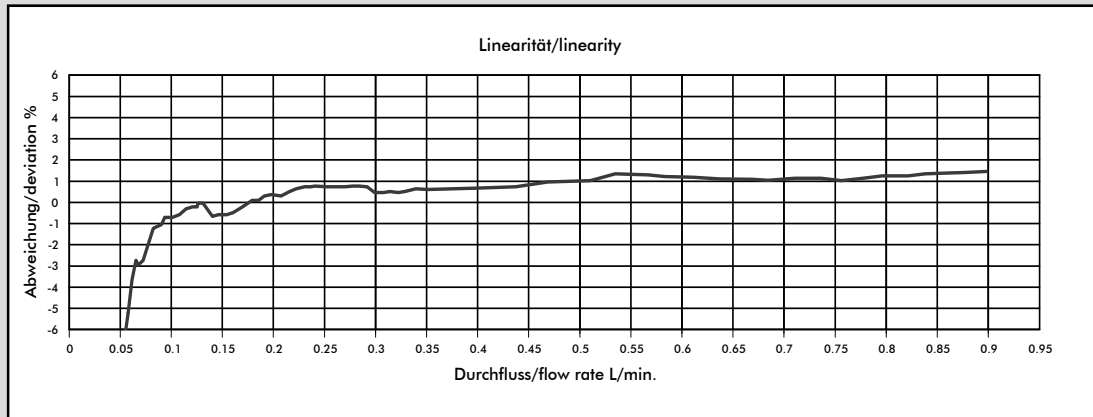

Medium: Water / max. Pressure: 1 bar

#932-9304/P2702 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2436 | 0.4105 | 0.0427 | 0.4019 | 0.48 |
| Ø 1.20 mm | 2012 | 0.4969 | 0.0801 | 0.5677 | 0.42 |
| Ø 1.80 mm | 1352 | 0.7397 | 0.0824 | 0.8982 | 0.26 |
| Ø 2.00 mm | 1274 | 0.7849 | 0.1573 | 0.9056 | 0.22 |

#932-9304/P2704 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4872 | 0.2052 | 0.0427 | 0.4019 | 0.48 |
| Ø 1.20 mm | 4024 | 0.2484 | 0.0801 | 0.5677 | 0.42 |
| Ø 1.80 mm | 2704 | 0.3698 | 0.0824 | 0.8982 | 0.26 |
| Ø 2.00 mm | 2548 | 0.3924 | 0.1573 | 0.9056 | 0.22 |

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.



We reserve the right to make modifications in the interests of technical progress.

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Version 01 FHKSC 932-930w/Pxxx GB 20V Seite 16-21

Measurement Curve FHKSC 2.00 mm 0° Arnite

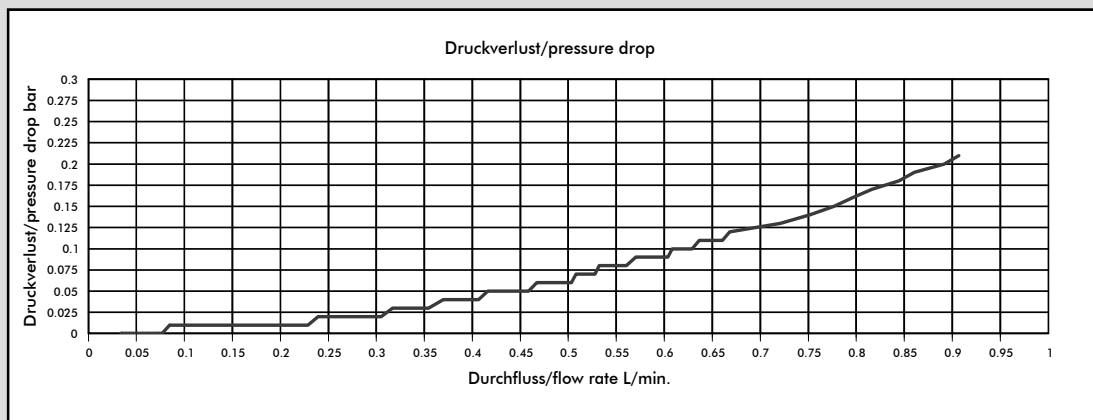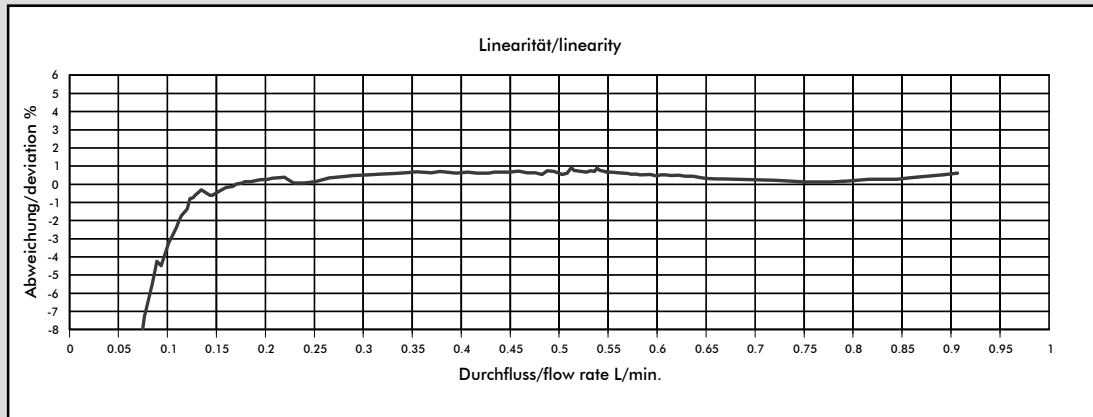

Medium: Water / max. Pressure: 1 bar

#932-9306/P2 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2382 | 0.4197 | 0.0333 | 0.4023 | 0.48 |
| Ø 1.20 mm | 1925 | 0.5194 | 0.0750 | 0.5692 | 0.42 |
| Ø 1.80 mm | 1315 | 0.7601 | 0.0753 | 0.8994 | 0.25 |
| Ø 2.00 mm | 1250 | 0.8001 | 0.1121 | 0.9068 | 0.21 |

#932-9306/P4 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4764 | 0.2098 | 0.0333 | 0.4023 | 0.48 |
| Ø 1.20 mm | 3850 | 0.2597 | 0.0750 | 0.5692 | 0.42 |
| Ø 1.80 mm | 2630 | 0.3800 | 0.0753 | 0.8994 | 0.25 |
| Ø 2.00 mm | 2500 | 0.4000 | 0.1121 | 0.9068 | 0.21 |

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.



We reserve the right to make modifications in the interests of technical progress.

Version 01 FHKSC 932-930w/Pxxx GB 20V Seite 17-21

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Measurement Curve FHKSC 2.00 mm 90° Arnite

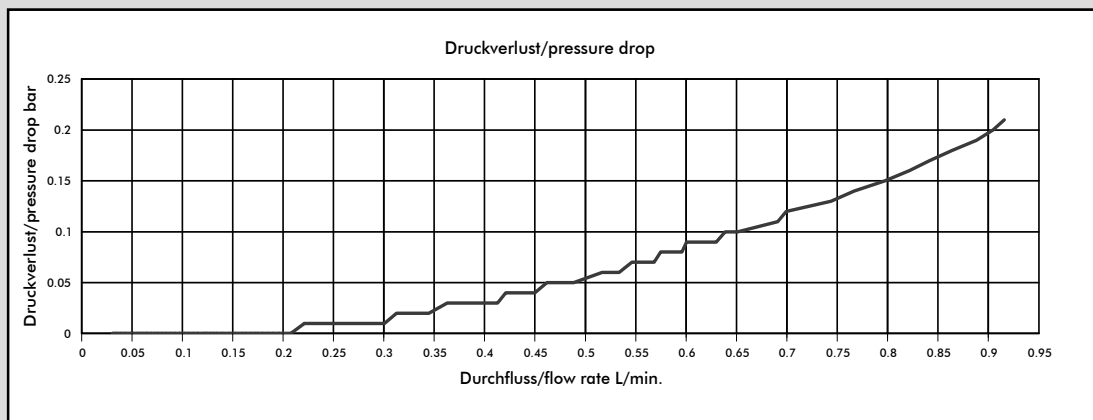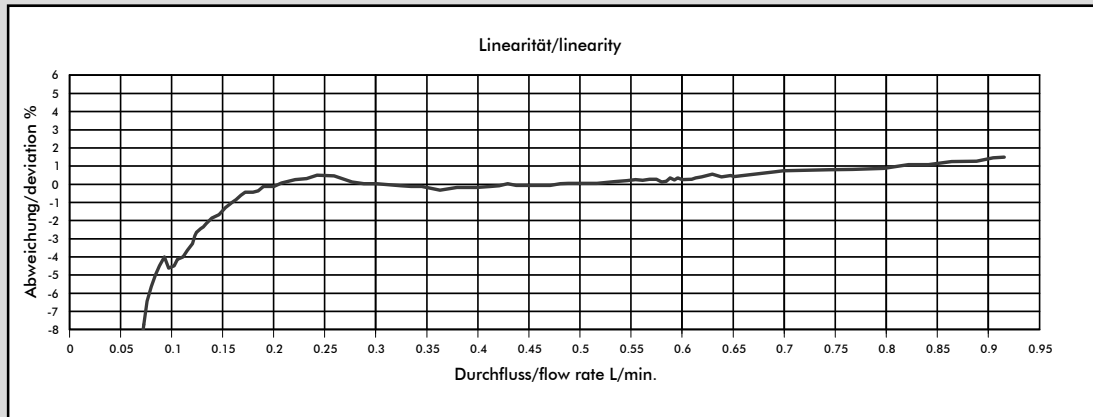

Medium: Water / max. Pressure: 1 bar

#932-9306/P902 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2386 | 0.4191 | 0.0500 | 0.4023 | 0.48 |
| Ø 1.20 mm | 1934 | 0.5171 | 0.0813 | 0.5667 | 0.43 |
| Ø 1.80 mm | 1300 | 0.7691 | 0.0910 | 0.9012 | 0.25 |
| Ø 2.00 mm | 1215 | 0.8231 | 0.1396 | 0.9156 | 0.21 |

#932-9306/P904 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4772 | 0.2095 | 0.0500 | 0.4023 | 0.48 |
| Ø 1.20 mm | 3868 | 0.2585 | 0.0813 | 0.5667 | 0.43 |
| Ø 1.80 mm | 2600 | 0.3845 | 0.0910 | 0.9012 | 0.25 |
| Ø 2.00 mm | 2430 | 0.4115 | 0.1396 | 0.9156 | 0.21 |

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.



We reserve the right to make modifications in the interests of technical progress.

Version 01 FHKSC 932-930w/Pxxx GB 20V Seite 18-21

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Measurement Curve FHKSC 2.00 mm 180° Arnite

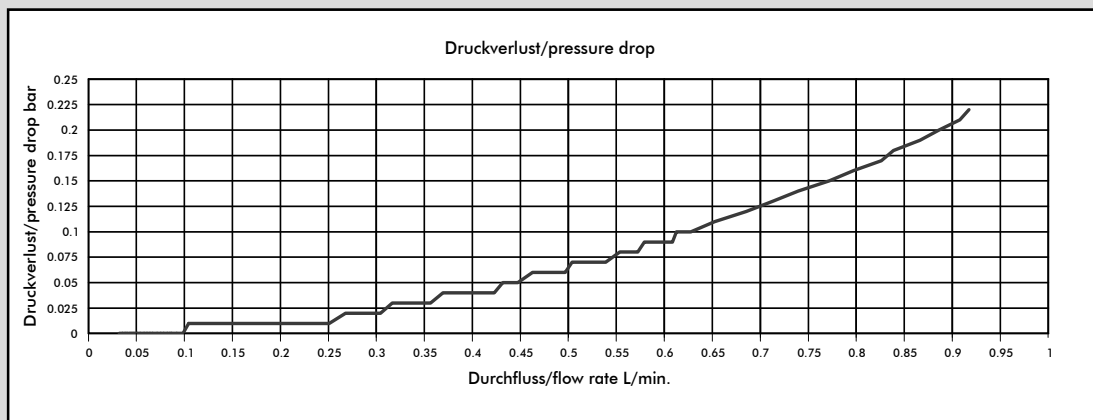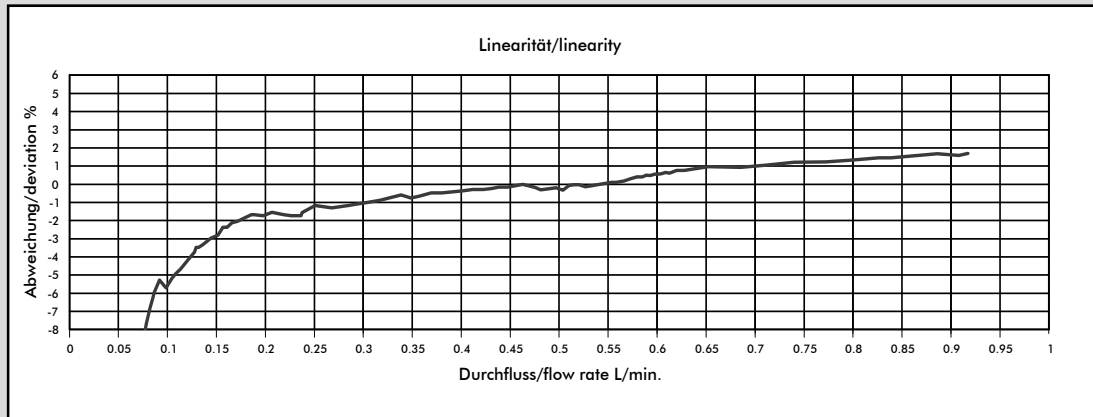

Medium: Water / max. Pressure: 1 bar

#932-9306/P1802 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2476 | 0.4038 | 0.0560 | 0.4044 | 0.48 |
| Ø 1.20 mm | 2016 | 0.4960 | 0.1022 | 0.5705 | 0.43 |
| Ø 1.80 mm | 1360 | 0.7349 | 0.1185 | 0.8966 | 0.26 |
| Ø 2.00 mm | 1280 | 0.7815 | 0.1785 | 0.9175 | 0.22 |

#932-9306/P1804 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4952 | 0.2019 | 0.0560 | 0.4044 | 0.48 |
| Ø 1.20 mm | 4032 | 0.2480 | 0.1022 | 0.5705 | 0.43 |
| Ø 1.80 mm | 2720 | 0.3674 | 0.1185 | 0.8966 | 0.26 |
| Ø 2.00 mm | 2560 | 0.3907 | 0.1785 | 0.9175 | 0.22 |

The values specified must be considered as approximate values.



The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Measurement Curve FHKSC 2.00 mm 270° Arnite

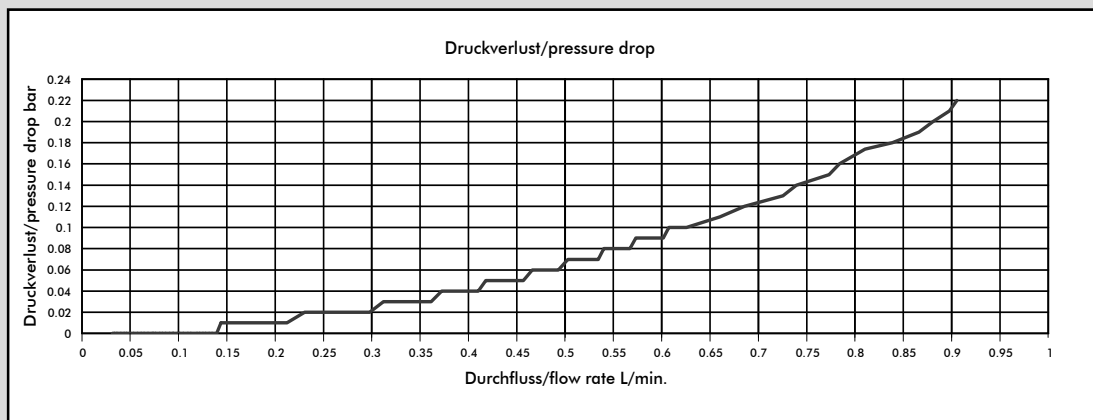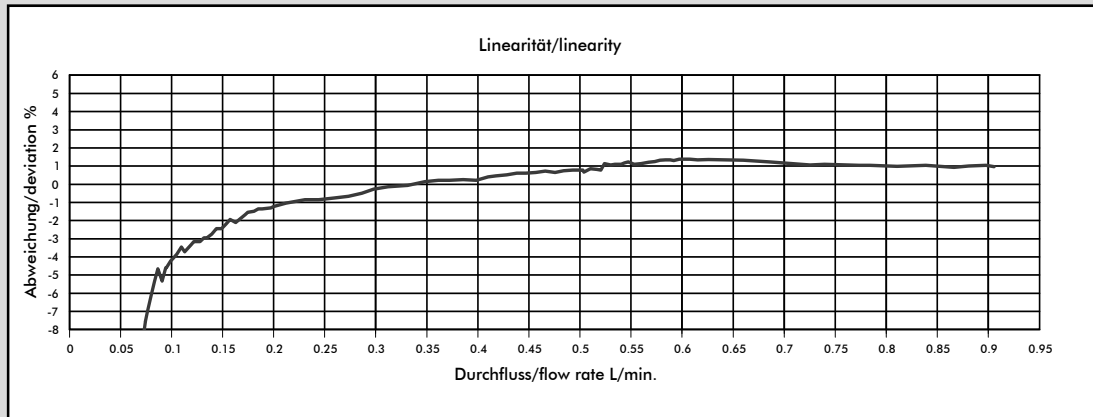

Medium: Water / max. Pressure: 1 bar

#932-9306/P2702 (2 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 2436 | 0.4105 | 0.0427 | 0.4019 | 0.48 |
| Ø 1.20 mm | 2012 | 0.4969 | 0.0801 | 0.5677 | 0.42 |
| Ø 1.80 mm | 1352 | 0.7397 | 0.0824 | 0.8982 | 0.26 |
| Ø 2.00 mm | 1274 | 0.7849 | 0.1573 | 0.9056 | 0.22 |

#932-9306/P2704 (4 Magnets Turbine)

| Nozzle size | Pulses/litre | g/pulse | min. flow rate in litres/min at Linear start | max. flow rate in litres/min | Pressure loss |
|-------------|--------------|---------|--|------------------------------|---------------|
| Ø 1.00 mm | 4872 | 0.2052 | 0.0427 | 0.4019 | 0.48 |
| Ø 1.20 mm | 4024 | 0.2484 | 0.0801 | 0.5677 | 0.42 |
| Ø 1.80 mm | 2704 | 0.3698 | 0.0824 | 0.8982 | 0.26 |
| Ø 2.00 mm | 2548 | 0.3924 | 0.1573 | 0.9056 | 0.22 |

The values specified must be considered as approximate values.

The number of pulses per litre may differ depending on medium and installation.

We recommend to calibrate the number of pulses per litre in line with the complete installation.


We reserve the right to make modifications in the interests of technical progress.

MEASUREMENT TIPS

- Ensure that there is no fast-pulsatory movement of the media
- Ensure that there are no reverse pressure surges
- Ensure that there is no air in the system
- Keep the pressure loss as small as possible
- Note the mounting position of the flowmeter
- Min/max flow should be in the linear range of the selected flowmeter
- Clean the system at appropriate intervals
- Avoid electrical current peaks
- Incorrect cabling of power supply +, signal and ground will destroy the flowmeter
- Do not mechanically load electrical contacts
- Avoid moisture on the electrical contacts
- Avoid stray pick-up via the cable (Do not lay cables in parallel with high current loads)

Version 01 FHKSC 932-930w/Pxxx GB 20V Seite 20-21

Spare parts:

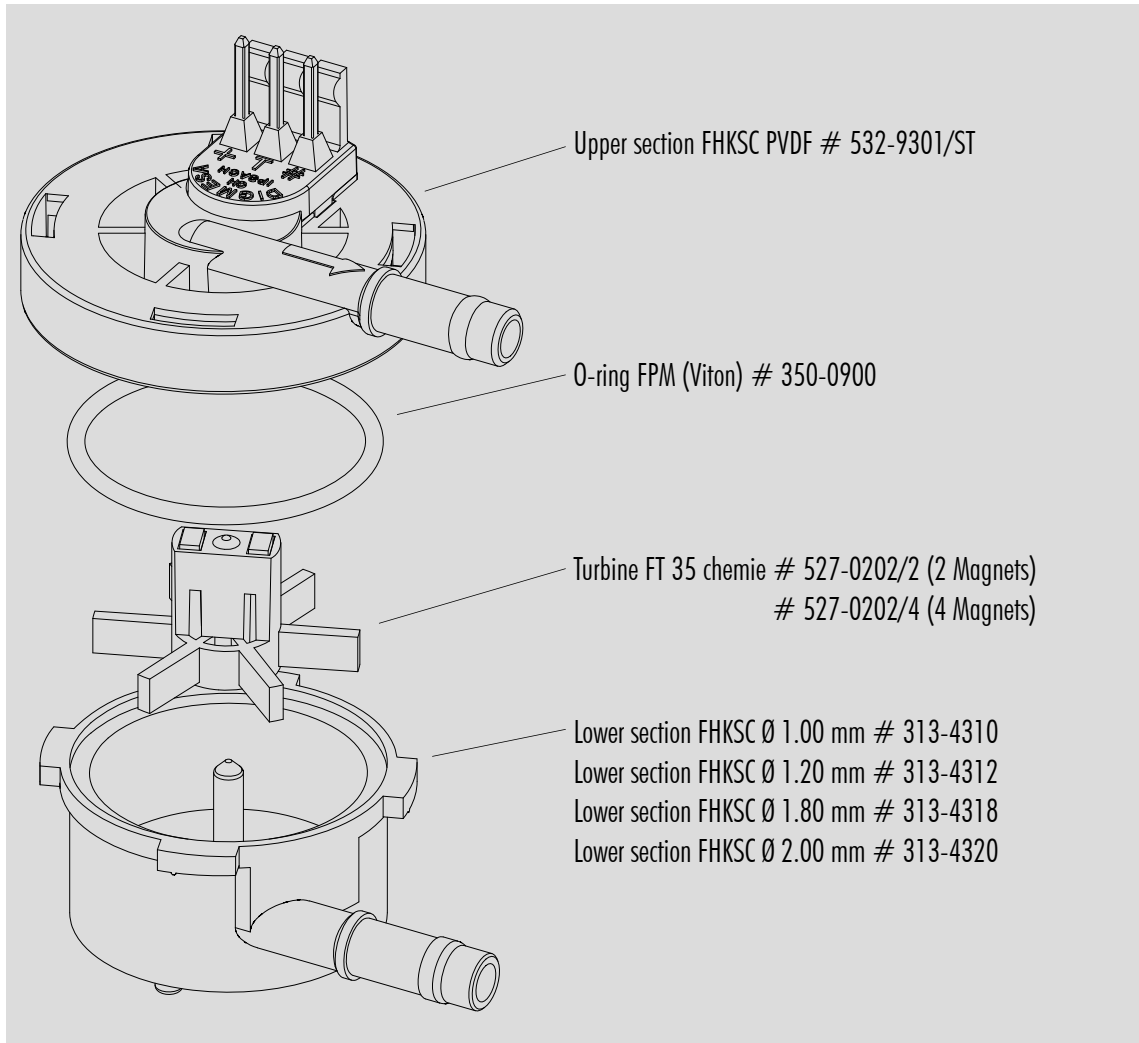

DIGMESA

| | | |
|-----------------|--|--|
| Notizen: | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |